


SERVICE ALERT

Issued 12th June 2015

Andair Ltd.,
Unit 1 Dunsbury Business Park,
Fullood Road,
HAVANT,
Hampshire PO9 5AX
UK.

This Service alert applies to all Diamond Aircraft fitted with this extension system. It has been brought to our attention that there could be a possible lack of engagement between the universal joint assembly and the top of the valve assembly. It is requested that a check be carried out to establish a minimum of engagement of 5mm with the dowel in the valve assembly. The picture below gives a maximum dimension of 4mm. Less than this can be considered satisfactory, this gives over 5mm engagement. Greater than this, the assembly should be investigated further and a new longer dowel be fitted. The longer dowels can be supplied.

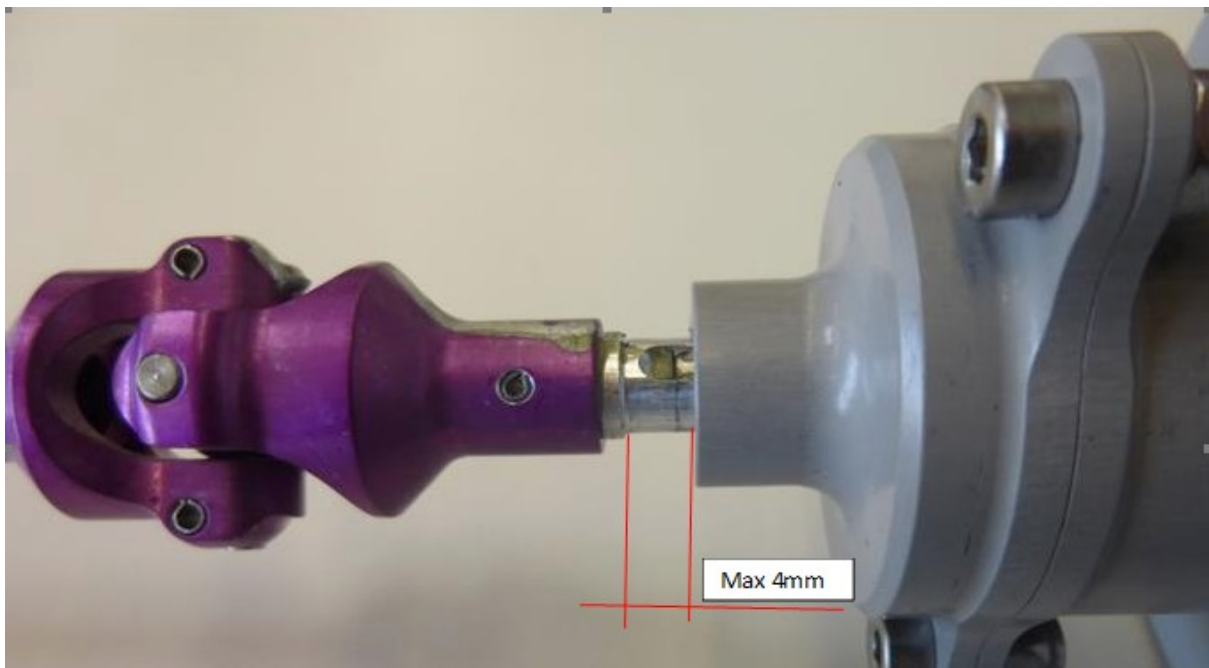

If further clarification is required please contact Andair Ltd.,
Contact e-mail: andair@andair.co.uk
TelephoneNo: 01144(0) 2392 473945